


# MILLING

## CUTTERS RX..

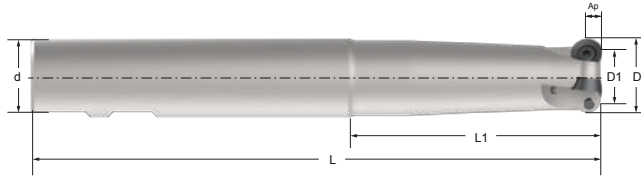

### END MILL RX.. - 10T3 M0

DESIGNATION	D	D1	d	L	L1	$A_p$	Z	$\alpha$	CATALOG #
LT 101 C-W-D025/3	25	15	25	117	60	5	3	10.0	M2001562
LT 101 C-W-D032/4	32	22	32	131	70	5	4	8.5	M2001563
LT 101 CL-W-D032/3	32	22	32	181	70	5	3	8.5	M2001564
LT 101 W-W-D025/3	25	15	25	92	35	5	3	10.0	M2001565
LT 101 W-W-D032/4	32	22	32	101	40	5	4	8.5	M2001566
LT 101 WL-W-D032/3	32	22	32	181	120	5	3	8.5	M2001567

SCREW M2003786  
KEY M2000602

### END MILL RX.. - 1204 M0

DESIGNATION	D	D1	d	L	L1	$A_p$	Z	$\alpha$	CATALOG #
LT 121 C-W-D040/4	40	28.0	40	141	70	6	4	7.5	M2001853
LT 121 W-W-D040/4	40	28.0	40	111	40	6	4	7.5	M2001854

SCREW M2000597  
KEY M2000602